 
## **TECHNICAL BULLETIN**

8/23/2022



NABCO 🔀

Technical Support Department

Techsupport@nabcoentrances.com

1-877-622-2694 Ext 3

## Opus Compatibility recommendations

When replacing Opus controls, it's best to pay attention to the current revision in use. Older control versions may not be ideal in certain door models, or may not even work at all.

To check the revision — Power must be applied to the control.



Start from the main display. If power is on and the screen is dark, just give the dial a brief push and it will light up.



Rotate the dial CW, just a couple clicks. The next display will show you the date of manufacture and revision.

Replace with the same revision or higher for proper operation Nabco Entrances recommends the following for best results:

- GT-710 : revision 21 and later
- GT-300,400,500,8300,8400,8500 : any revision should be fine
- Simultaneous Pairs : revision 21 and later work best
- GT-1175 retrofits using U19 and older style operators : revision 20 or later
- GT-1175 with VS-150 operator : must have revision 27 or later
- DS-150 operators are not compatible with the Opus control

There may be special exceptions outside the above mentioned where certain revisions may or may not work. If questionable, contact tech-support.

Bulletin Number: 116

Technical Bulletin

Technical Bulletin