

NABCO ENTRANCES TECHNICAL BULLETIN

Gyro Tech Lanson Parts Zone Gard
S82 W18717 Gemini Drive
Muskego, Wisconsin 53150
Phone: 1-414-679-0045
Fax (toll free): 1-888-679-3319

Effective Date: March 29, 1999


Who is the technical contact?
Tom Holdorf

Modification for Radio Controlled Transmitters

We have received reports of pulse extender boards having weak signals. As a result, they were not picked up by the receiver.

To strengthen the signal:

1. Remove the RED wire from the switch going to the pulse extender board.
2. Cut this wire off at the board.
3. Solder a wire onto the radio controlled transmitter board where the red battery wire is soldered.
4. Attach the other end of this wire to the switch.

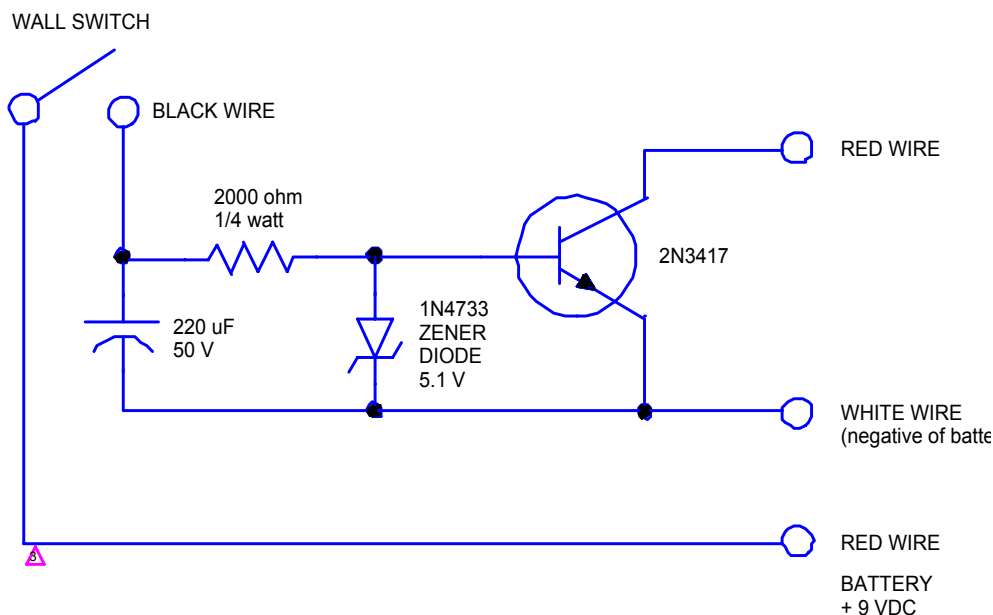

Bulletin Number: **14**