

NABCO ENTRANCES TECHNICAL BULLETIN


Gyro Tech Lanson Parts Zone Gard
S82 W18717 Gemini Drive
Muskego, Wisconsin 53150
Phone: 1-414-679-0045
Fax (toll free): 1-888-679-3319

Effective Date: 3-25-98


Who is the technical contact?
Mike Laeuger

1175 Full Open Bottom Guide Change

To eliminate interference between the housing casting of the bottom guide and the “T” nut of the tie rod assembly inside the bottom rail of the full open door, the casting supporting the shoulder bolt has been changed. This redesign will negate the rubbing or stickiness in the door rotation when the door is panicked open.

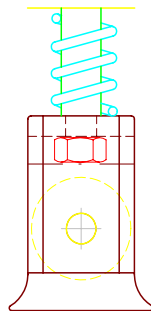

Profile
of Old Design

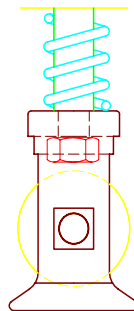

Profile
of New Design

The new casting was also designed to raise the nut holding the shoulder bolt farther from wheel. In some cases, a washer was needed between the shoulder bolt and the casting to prevent the end of the bolt from rubbing on the wheel. This will no longer be necessary with the new casting.

The new part is a direct replacement for the old part. Since they are installed in the factory, no additional work is required of the installed due to this change. It fits into the same track and the mounting holes on the stiles remain the same. The new parts are due from the casting company in mid to late May. They will be appearing in the 1175 Whisper Slide shortly after that.

Bulletin Number: 3
