

NABCO ENTRANCES TECHNICAL BULLETIN

S82 W18717 Gemini Drive, PO Box 906
Muskego, WI, 53150
Phone: (877) 622-2694, Fax: (888) 679-3319
www.NabcoEntrances.com

Muskego, WI, 53150

Phone: (877) 622-2694, Fax: (888) 679-3319

www.NabcoEntrances.com

Effective Date: March 30, 2006

Who is the technical contact?
Mike Buckley or Rick Filas

Mike Buckley or Rick Filas

ANALOG CONTROL - DOOR HESITATION AND/OR CREEP MODE PROBLEMS

Issue: A small percentage of Gyro Tech swing door analog controls have been reported to have one or more of the following conditions:

1. The unit may hesitate for about 3-5 seconds before opening.
2. Unit may switch back and forth into and out of creep mode.
3. Unit will stay in creep mode.



- Unit may switch back and forth into and out of creep mode.

3. Unit will stay in creep mode.

Reason: The Magnacraft brand motor protector relay with the orange indicator has malfunctioned.

Solution: If you have an analog control with the Magnacraft motor protector relay (with the orange indicator) and are experiencing one or more of the conditions noted above, call Customer Service for a warranty replacement P/N 24-0952. Note: remove the old relay from the control and return to Nabco for replacement. If you have already returned an analog control to Nabco, the Magnacraft relay will automatically have been replaced.

Refer to illustrations below.

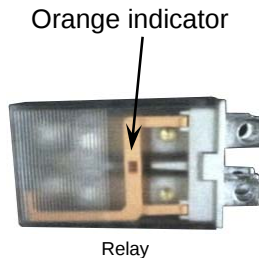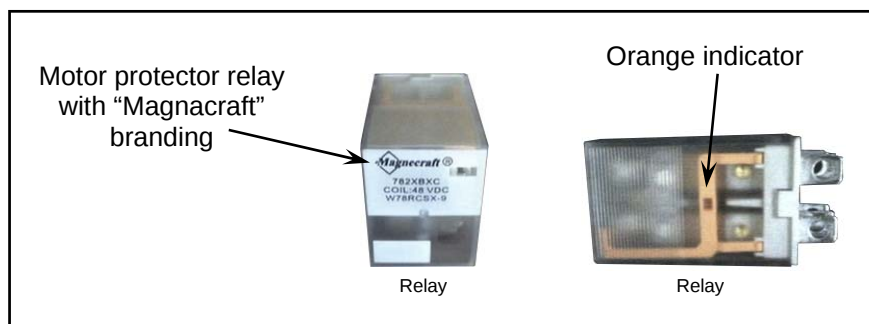

Motor Protector Relay
Part # 24-0952

Part # 24-0952

(Also posted on website)

Bulletin Number: **38**

Note: Does not apply to GT-500 Standard Mode Controls