




Technical Bulletin

Date	Bulletin #	Model
[11/12/2024]	124	Affects All Doors Using Opus Control
Subject Changes to Opus control for Revision F32		

Lock Release Force

“Lock Release Force” has been added under output settings. This setting is available when the relay output is set for electric lock.

Previous revisions automatically pulled closed to help release an electric strike, but now that force is adjustable.

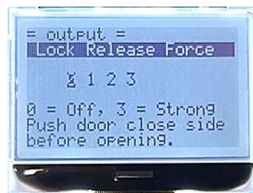


Encoder Inspection

A screen has been added to check the functionality of the motor’s encoder.

Go to the settings menu, then to “history data”. From that screen, rotate clockwise to the “insp.” screen.

At this display, you can move the door very slowly by hand. As the door moves, “Enc.A” and “Enc.B” will change between being highlighted and not highlighted. Note that the VS-150 operator will also have an “Enc.C”

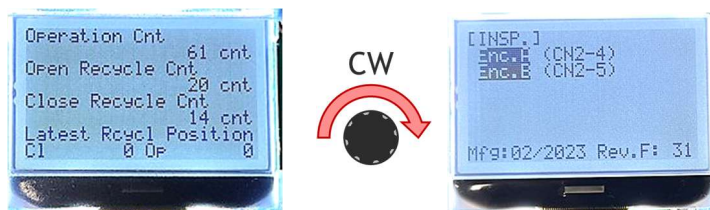

12VDC

RevF32 control now provides up to 900mA @ 12VDC. Previous controls provided 750mA. Nabco still advises not to power an electric lock from the control.

Layout Change

The control now has a new sturdier cover placed over the board

The programming dial has moved a little closer to the corner of the control and has a taller knob for easier use.